Operating instructions





Welding machine

Pico 220 cel puls Pico 220 cel puls vrd (AUS) Pico 220 cel puls vrd (RU)

099-002057-EW501

Observe additional system documents!

04.03.2019

Register now and benefit!

Jetzt Registrieren und Profitieren!

www.ewm-group.com



General instructions

MARNING



Read the operating instructions!

The operating instructions provide an introduction to the safe use of the products.

- Read and observe the operating instructions for all system components, especially the safety instructions and warning notices!
- Observe the accident prevention regulations and any regional regulations!
- The operating instructions must be kept at the location where the machine is operated.
- Safety and warning labels on the machine indicate any possible risks.
 Keep these labels clean and legible at all times.
- The machine has been constructed to state-of-the-art standards in line with any applicable regulations and industrial standards. Only trained personnel may operate, service and repair the machine.
- Technical changes due to further development in machine technology may lead to a differing welding behaviour.

In the event of queries on installation, commissioning, operation or special conditions at the installation site, or on usage, please contact your sales partner or our customer service department on +49 2680 181-0.

A list of authorised sales partners can be found at www.ewm-group.com/en/specialist-dealers.

Liability relating to the operation of this equipment is restricted solely to the function of the equipment. No other form of liability, regardless of type, shall be accepted. This exclusion of liability shall be deemed accepted by the user on commissioning the equipment.

The manufacturer is unable to monitor whether or not these instructions or the conditions and methods are observed during installation, operation, usage and maintenance of the equipment.

An incorrectly performed installation can result in material damage and injure persons as a result. For this reason, we do not accept any responsibility or liability for losses, damages or costs arising from incorrect installation, improper operation or incorrect usage and maintenance or any actions connected to this in any way.

© EWM AG

Dr. Günter-Henle-Strasse 8 56271 Mündersbach Germany Tel.: +49 2680 181-0, Fax: -244 Email: info@ewm-group.com

www.ewm-group.com

The copyright to this document remains the property of the manufacturer.

Copying, including extracts, only permitted with written approval.

The content of this document has been prepared and reviewed with all reasonable care. The information provided is subject to change; errors excepted.



1 Contents

1	Conte	ents		3
2	For y	our safet	у	5
	2.1	Notes on	the use of these operating instructions	5
	2.2		tion of icons	
	2.3	Part of th	ne complete documentation	6
	2.4	Safety in	structions	8
	2.5	Transpor	rt and installation	12
3	Inten	ded use		13
	3.1		ons	
	3.2		e version	
	3.3		nts which also apply	
		3.3.1	Warranty	
		3.3.2	Declaration of Conformity	13
		3.3.3	Welding in environments with increased electrical hazards	13
		3.3.4	Service documents (spare parts and circuit diagrams)	13
		3.3.5	Calibration/Validation	14
4	Mach	ine desci	ription – quick overview	15
	4.1		PW	
	4.2		W	
	4.3		control – Operating elements	
5	Desic	n and fu	nction	19
•	5.1	•	rt and installation	
	0	5.1.1	Machine cooling	
		5.1.2	Workpiece lead, general	
		5.1.3	Ambient conditions	
			5.1.3.1 In operation	
			5.1.3.2 Transport and storage	
		5.1.4	Adjusting the length of the carrying strap	
		5.1.5	Notes on the installation of welding current leads	
		5.1.6	Stray welding currents	
		5.1.7	Mains connection	21
			5.1.7.1 Mains configuration	22
	5.2	MMA we	elding	
		5.2.1	Connecting the electrode holder and workpiece lead	
		5.2.2	Welding task selection	
		5.2.3	Hotstart	
		5.2.4	Arcforce	
		5.2.5	Antistick	
		5.2.6	Average value pulse welding	
		5.2.7	Expert menu (MMA)	
	5.3		ding	
		5.3.1	Shielding gas supply (shielding gas cylinder for welding machine)	
			5.3.1.1 Connecting the shielding gas supply	
		5.3.2	Connecting a TIG welding torch with rotating gas valve	
		5.3.3	Welding task selection	
		5.3.4	Arc ignition	
			5.3.4.1 Liftarc	29



		5.3.5	Average value pulse welding	29
		5.3.6	Expert menu (TIG)	
	5.4	Dirt filter	r	31
	5.5	Remote	control	31
		5.5.1	RT1 19POL	31
		5.5.2	RTG1 19POL	32
		5.5.3	RTF1 19POL	32
	5.6	Power-s	saving mode (Standby)	32
	5.7		gth restriction (USP)	
	5.8		reducing device	
	5.9	Machine	e configuration menu	33
6	Main	tenance,	, care and disposal	34
	6.1	General		34
	6.2	Cleaning	g	34
		6.2.1	Dirt filter	34
	6.3	Mainten	nance work, intervals	35
		6.3.1	Daily maintenance tasks	35
		6.3.2	Monthly maintenance tasks	
		6.3.3	Annual test (inspection and testing during operation)	
	6.4	•	ng of equipment	
7	Recti	ifying fau	ults	37
	7.1	Checklis	st for rectifying faults	37
	7.2		e faults (error messages)	
	7.3		machine control software version	
	7.4	Resettin	ng welding parameters to the factory settings	39
8	Tech	nical dat	ta	40
	8.1	Pico 220	0 cel puls	40
9	Acce	essories .		41
	9.1		ort systems	
	9.2		e controls and accessories	
	9.3	General	l accessories	41
	9.4	Options		41
10	Anne	endix		42
. •	10.1		eter overview	
		10.1.1	MMA welding	
		10.1.2	TIG welding	
		10.1.3	Basic parameters (independent of process)	
	10.2		ng for a dealer	



2 For your safety

2.1 Notes on the use of these operating instructions

△ DANGER

Working or operating procedures which must be closely observed to prevent imminent serious and even fatal injuries.

- Safety notes include the "DANGER" keyword in the heading with a general warning symbol.
- The hazard is also highlighted using a symbol on the edge of the page.

△ WARNING

Working or operating procedures which must be closely observed to prevent serious and even fatal injuries.

- Safety notes include the "WARNING" keyword in the heading with a general warning symbol.
- The hazard is also highlighted using a symbol in the page margin.

▲ CAUTION

Working or operating procedures which must be closely observed to prevent possible minor personal injury.

- The safety information includes the "CAUTION" keyword in its heading with a general warning symbol.
- The risk is explained using a symbol on the edge of the page.

Technical aspects which the user must observe to avoid material or equipment damage.

Instructions and lists detailing step-by-step actions for given situations can be recognised via bullet points, e.g.:

• Insert the welding current lead socket into the relevant socket and lock.




Explanation of icons 2.2

Symbol	Description	Symbol	Description
B	Indicates technical aspects which the user must observe.		Activate and release / Tap / Tip
	Switch off machine		Release
0	Switch on machine		Press and hold
		(1) E	Switch
(X)	Incorrect / Invalid	@ <u>\$</u>	Turn
	Correct / Valid		Numerical value – adjustable
-	Input		Signal light lights up in green
①	Navigation	••••	Signal light flashes green
	Output	-:	Signal light lights up in red
4s.	Time representation (e.g.: wait 4 s / actuate)	•••••	Signal light flashes red
-//-	Interruption in the menu display (other setting options possible)		
	Tool not required/do not use		
	Tool required/use		

2.3 Part of the complete documentation

These operating instructions are part of the complete documentation and valid only in combination with all other parts of these instructions! Read and observe the operating instructions for all system components, especially the safety instructions!

The illustration shows a general example of a welding system.

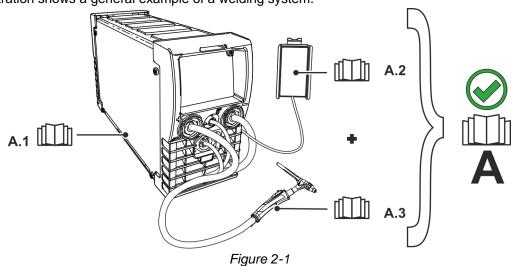





Item	Documentation
A.1	Power source
A.2	Remote control
A.3	Welding torch
A	Complete documentation



2.4 Safety instructions



⚠ WARNING

Risk of accidents due to non-compliance with the safety instructions! Non-compliance with the safety instructions can be fatal!

- Carefully read the safety instructions in this manual!
- Observe the accident prevention regulations and any regional regulations!
- Inform persons in the working area that they must comply with the regulations!



Risk of injury from electrical voltage!

Voltages can cause potentially fatal electric shocks and burns on contact. Even low voltages can cause a shock and lead to accidents.

- Never touch live components such as welding current sockets or stick, tungsten or wire electrodes!
- Always place torches and electrode holders on an insulated surface!
- Wear the full personal protective equipment (depending on the application)!
- The machine may only be opened by qualified personnel!
- The device must not be used to defrost pipes!



Hazard when interconnecting multiple power sources!

If a number of power sources are to be connected in parallel or in series, only a technical specialist may interconnect the sources as per standard *IEC 60974-9:2010:*Installation and use and German Accident Prevention Regulation BVG D1 (formerly VBG 15) or country-specific regulations.

Before commencing arc welding, a test must verify that the equipment cannot exceed the maximum permitted open circuit voltage.

- Only qualified personnel may connect the machine.
- When taking individual power sources out of operation, all mains and welding current leads must be safely disconnected from the welding system as a whole. (Hazard due to reverse polarity voltage!)
- Do not interconnect welding machines with pole reversing switch (PWS series) or machines for AC welding since a minor error in operation can cause the welding voltages to be combined, which is not permitted.



Risk of injury due to improper clothing!

During arc welding, radiation, heat and voltage are sources of risk that cannot be avoided. The user has to be equipped with the complete personal protective equipment at all times. The protective equipment has to include:

- Respiratory protection against hazardous substances and mixtures (fumes and vapours);
 otherwise implement suitable measures such as extraction facilities.
- Welding helmet with proper protection against ionizing radiation (IR and UV radiation) and heat.
- Dry welding clothing (shoes, gloves and body protection) to protect against warm environments with conditions comparable to ambient temperatures of 100 °C or higher and arcing and work on live components.
- Hearing protection against harming noise.



Risk of injury due to radiation or heat!

Arc radiation can lead to skin and eye injuries.

Contact with hot workpieces and sparks can lead to burns.

- Use hand shield or welding helmet with the appropriate safety level (depends on the application).
- Wear dry protective clothing (e.g. hand shield, gloves, etc.) in accordance with the applicable regulations of your country.
- Persons who are not directly involved should be protected with a welding curtain or suitable safety screen against radiation and the risk of blinding!

8 099-002057-EW501





⚠ WARNING



Explosion risk!

Apparently harmless substances in closed containers may generate excessive pressure when heated.

- · Move containers with inflammable or explosive liquids away from the working area!
- Never heat explosive liquids, dusts or gases by welding or cutting!



Fire hazard!

Due to the high temperatures, sparks, glowing parts and hot slag that occur during welding, there is a risk of flames.

- · Be watchful of potential sources of fire in the working area!
- Do not carry any easily inflammable objects, e.g. matches or lighters.
- Ensure suitable fire extinguishers are available in the working area!
- Thoroughly remove any residue of flammable materials from the workpiece prior to starting to weld.
- Only further process workpieces after they have cooled down. Do not allow them to contact any flammable materials!



A CAUTION



Smoke and gases!

Smoke and gases can lead to breathing difficulties and poisoning. In addition, solvent vapour (chlorinated hydrocarbon) may be converted into poisonous phosgene due to the ultraviolet radiation of the arc!

- · Ensure that there is sufficient fresh air!
- Keep solvent vapour away from the arc beam field!
- Wear suitable breathing apparatus if appropriate!

 


Noise exposure!

 
Noise exceeding 70 dBA can cause permanent hearing damage!

- · Wear suitable ear protection!
- Persons located within the working area must wear suitable ear protection!











Class B machines fulfil the EMC requirements in industrial as well as residential areas, including residential areas connected to the low-voltage public mains network.

Setting up and operating

When operating arc welding systems, in some cases, electro-magnetic interference can occur although all of the welding machines comply with the emission limits specified in the standard. The user is responsible for any interference caused by welding.

In order to **evaluate** any possible problems with electromagnetic compatibility in the surrounding area, the user must consider the following: (see also EN 60974-10 Appendix A)

- Mains, control, signal and telecommunication lines
- Radios and televisions
- Computers and other control systems
- · Safety equipment
- The health of neighbouring persons, especially if they have a pacemaker or wear a hearing aid
- Calibration and measuring equipment
- · The immunity to interference of other equipment in the surrounding area
- The time of day at which the welding work must be carried out

Recommendations for reducing interference emission

- Mains connection, e.g. additional mains filter or shielding with a metal tube
- Maintenance of the arc welding system
- Welding leads should be as short as possible and run closely together along the ground
- · Potential equalization
- Earthing of the workpiece. In cases where it is not possible to earth the workpiece directly, it should be connected by means of suitable capacitors.
- Shielding from other equipment in the surrounding area or the entire welding system



Electromagnetic fields!

The power source may cause electrical or electromagnetic fields to be produced which could affect the correct functioning of electronic equipment such as IT or CNC devices, telecommunication lines, power cables, signal lines and pacemakers.



- Observe the maintenance instructions > see 6.3 chapter!
- · Unwind welding leads completely!
- Shield devices or equipment sensitive to radiation accordingly!
- The correct functioning of pacemakers may be affected (obtain advice from a doctor if necessary).

099-002057-EW501 04.03.2019









Obligations of the operator!

The respective national directives and laws must be complied with when operating the machine!

- Implementation of national legislation relating to framework directive 89/391/EEC on the introduction of measures to encourage improvements in the safety and health of workers at work and associated individual guidelines.
- In particular, directive 89/655/EEC concerning the minimum safety and health requirements for the use of work equipment by workers at work.
- The regulations applicable to occupational safety and accident prevention in the country concerned.
- Setting up and operating the machine as per IEC 60974.-9.
- Brief the user on safety-conscious work practices on a regular basis.
- Regularly inspect the machine as per IEC 60974.-4.



The manufacturer's warranty becomes void if non-genuine parts are used!

- Only use system components and options (power sources, welding torches, electrode holders, remote controls, spare parts and replacement parts, etc.) from our range of products!
- Only insert and lock accessory components into the relevant connection socket when the machine is switched off.

Requirements for connection to the public mains network

High-performance machines can influence the mains quality by taking current from the mains network. For some types of machines, connection restrictions or requirements relating to the maximum possible line impedance or the necessary minimum supply capacity at the interface with the public network (Point of Common Coupling, PCC) can therefore apply. In this respect, attention is also drawn to the machines' technical data. In this case, it is the responsibility of the operator, where necessary in consultation with the mains network operator, to ensure that the machine can be connected.



2.5 Transport and installation

Risk of injury due to





Risk of injury due to improper handling of shielding gas cylinders! Improper handling and insufficient securing of shielding gas cylinders can cause serious injuries!

- Observe the instructions from the gas manufacturer and any relevant regulations concerning the use of compressed air!
- Do not attach any element to the shielding gas cylinder valve!
- · Prevent the shielding gas cylinder from heating up.

▲ CAUTION



Risk of accidents due to supply lines!

During transport, attached supply lines (mains leads, control cables, etc.) can cause risks, e.g. by causing connected machines to tip over and injure persons!

Disconnect all supply lines before transport!



Risk of tipping!

There is a risk of the machine tipping over and injuring persons or being damaged itself during movement and set up. Tilt resistance is guaranteed up to an angle of 10° (according to IEC 60974-1).

- Set up and transport the machine on level, solid ground.
- Secure add-on parts using suitable equipment.



Risk of accidents due to incorrectly installed leads! Incorrectly installed leads (mains, control and welding leads or intermediate hose packages) can present a tripping hazard.

- Lay the supply lines flat on the floor (avoid loops).
- · Avoid laying the leads on passage ways.
- The units are designed for operation in an upright position!

 Operation in non-permissible positions can cause equipment damage.
 - Only transport and operate in an upright position!
- B

Accessory components and the power source itself can be damaged by incorrect connection!

- Only insert and lock accessory components into the relevant connection socket when the machine is switched off.
- Comprehensive descriptions can be found in the operating instructions for the relevant accessory components.
- · Accessory components are detected automatically after the power source is switched on.
- Protective dust caps protect the connection sockets and therefore the machine against dirt and damage.
 - The protective dust cap must be fitted if there is no accessory component being operated on that connection.
 - The cap must be replaced if faulty or if lost!



3 Intended use

▲ WARNING



Hazards due to improper usage!

The machine has been constructed to the state of the art and any regulations and standards applicable for use in industry and trade. It may only be used for the welding procedures indicated at the rating plate. Hazards may arise for persons, animals and material objects if the equipment is not used correctly. No liability is accepted for any damages arising from improper usage!

- The equipment must only be used in line with its designated purpose and by trained or expert personnel!
- Do not improperly modify or convert the equipment!

3.1 Applications

Arc welding machine for MMA DC welding with TIG DC welding with lift arc (touch starting) as secondary process.

3.2 Software version

These instructions apply to the following software version: 0.5.5.0

The software version of the machine control can be displayed in the machine configuration menu (menu Srv) > see 5.9 chapter.

3.3 Documents which also apply

3.3.1 Warranty

For more information refer to the "Warranty registration" brochure supplied and our information regarding warranty, maintenance and testing at www.ewm-group.com!

3.3.2 Declaration of Conformity

The labelled product complies with the following EC directives in terms of its design and construction:



- Low Voltage Directive (LVD)
- Electromagnetic Compatibility Directive (EMC)
- Restriction of Hazardous Substance (RoHS)

In case of unauthorised changes, improper repairs, non-compliance with specified deadlines for "Arc Welding Equipment – Inspection and Testing during Operation," and/or prohibited modifications which have not been explicitly authorised by the manufacturer, this declaration shall be voided. An original document of the specific declaration of conformity is included with every product.

3.3.3 Welding in environments with increased electrical hazards



In compliance with IEC / DIN EN 60974, VDE 0544 the machines can be used in environments with an increased electrical hazard.

3.3.4 Service documents (spare parts and circuit diagrams)



⚠ WARNING

Do not carry out any unauthorised repairs or modifications!

To avoid injury and equipment damage, the unit must only be repaired or modified by specialist, skilled persons!

The warranty becomes null and void in the event of unauthorised interference.

Appoint only skilled persons for repair work (trained service personnel)!

Original copies of the circuit diagrams are enclosed with the unit.

Spare parts can be obtained from the relevant authorised dealer.

Intended use

Documents which also apply




3.3.5 Calibration/Validation

We hereby confirm that this product was tested with calibrated measuring equipment according to the applicable standards IEC/EN 60974, ISO/EN 17662, EN 50504 and complies with the permissible tolerances. Recommended calibration interval: 12 months.



4 Machine description – quick overview

4.1 Front view

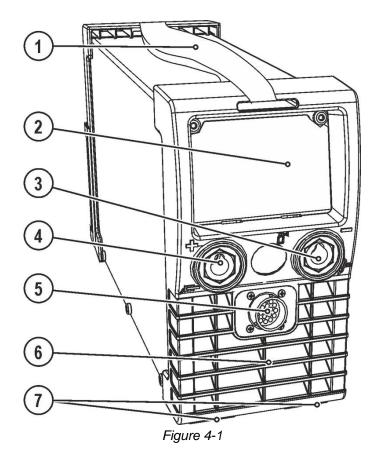

Symbol **Description** Item Carrying strap > see 5.1.4 chapter 1 2 Machine control > see 4.3 chapter Connection socket, "-" welding current 3 TIG: Welding current lead connection for TIG welding torch MMA: Electrode holder or workpiece lead connection Connection socket, "+" welding current 4 MMA: Electrode holder or workpiece lead connection TIG: Connection for workpiece lead Connection socket, 19-pole 5 Remote control connection Cooling air outlet 6 **Machine feet**

099-002057-EW501 04.03.2019



4.2 **Rear view**


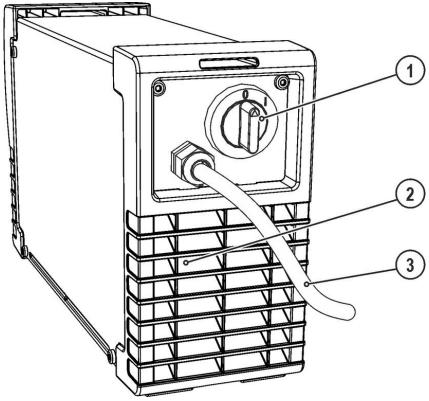


Figure 4-2


Item	Symbol	Description
1		Main switch, machine on/off
2		Cooling air inlet
3		Mains connection cable > see 5.1.7 chapter



Machine control – Operating elements 4.3

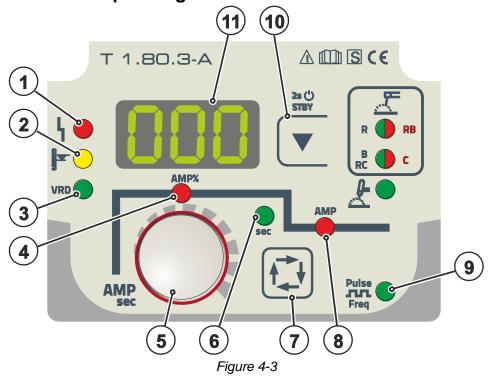

 Machine description – quick overview Machine control – Operating elements





Item	Symbol	Description	
1	L	Collective interference signal light	
	1	For error messages, > see 7 chapter	
2		Excess temperature signal light	
		In case of excess temperature, temperature monitors de-activate the power unit, and	
		the excess temperature control lamp comes on. Once the machine has cooled down, welding can continue without any further measures.	
3	VRD	Voltage reduction device (VRD) signal light > see 5.8 chapter	
4	AMP%	Hotstart current signal light	
5	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	Welding parameter setting rotary transducer	
		Setting of welding current and other welding parameter and their values	
6	sec	Hotstart time signal light	
7	→	Select welding parameters button	
	T₩	This button is used to select the welding parameters depending on the welding process	
		and operating mode used.	
8	AMP	Main current signal light	
	Dulas	Imin to Imax (1 A increments)	
9	Pulse	Pulse welding (average value pulses) signal light > see 5.2.6 chapter	
	Freq	On: Function switched on on	
		Not on: Function switched off off	
		Flashing: Parameter selection and frequency setting	
10		Welding procedure/power-saving mode push-button ∠ Selection of MMA welding procedure/electrode type setting	
		Signal light Representation of Mina weighing procedure/electrode type setting	
		Signal light R RB illuminated in red = electrode type rutile basic	
		Signal light RB or illuminated in green = electrode type basic/rutile cellulose	
		Signal light R or illuminated in red = electrode type cellulose	
		₹ Selection of TIG welding procedure	
		Press for 2 s to put the machine into power-saving mode. To reactivate, activate one of	
	666	the operating elements > see 5.6 chapter.	
11		Display, 3-digit	

 
099-002057-EW501 04.03.2019 18



5 Design and function


5.1 Transport and installation

New York Nisk of accident due



The machine must not be suspended or lifted using a crane.

 5.1.1 Machine cooling



- Observe the ambient conditions!
- Keep the cooling air inlet and outlet clear!
- Observe the minimum distance of 0.5 m from obstacles!

5.1.2 Workpiece lead, general

△ CAUTION



 
Risk of burning due to incorrect welding current connection!

If the welding current plugs (machine connections) are not locked or if the workpiece connection is contaminated (paint, corrosion), these connections and leads can heat up and cause burns when touched!

WARNING

- Check welding current connections on a daily basis and lock by turning to the right when necessary.
- Clean workpiece connection thoroughly and secure properly. Do not use structural parts of the workpiece as welding current return lead!

5.1.3 Ambient conditions



- The operator must ensure that the ground is non-slip and level, and provide sufficient lighting for the place of work.
- Safe operation of the machine must be guaranteed at all times.

Equipment damage due to contamination!

Unusually high amounts of dust, acids, corrosive gases or substances can damage the machine (observe maintenance intervals > see 6.3 chapter).

· Avoid large amounts of smoke, steam, oily fumes, grinding dust and corrosive ambient air!

5.1.3.1 In operation

Temperature range of the ambient air:

• -25 °C to +40 °C (-13 °F to 104 °F)

Relative humidity:

- up to 50 % at 40 °C (104 °F)
- up to 90 % at 20 °C (68 °F)

5.1.3.2 Transport and storage

Storage in a closed room, temperature range of the ambient air:

-30 °C to +70 °C (-22 °F to 158 °F)


Relative humidity

up to 90 % at 20 °C (68 °F)



5.1.4 Adjusting the length of the carrying strap

To demonstrate adjustment, lengthening the strap is shown in the figure. To shorten, the strap's loops must be inched in the opposite direction.

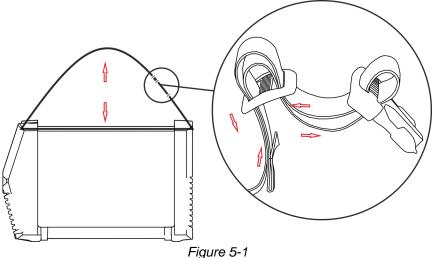

5.1.5 Notes on the installation of welding current leads

Use an individual welding lead to the workpiece for each welding machine!

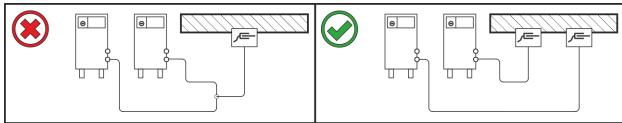


Figure 5-2

- Fully unroll welding current leads, torch hose packages and intermediate hose packages. Avoid loops!
- Always keep leads as short as possible!

Lay any excess cable lengths in meanders.



Figure 5-3



5.1.6 Stray welding currents

▲ WARNING



Risk of injury due to stray welding currents!

Stray welding currents can destroy protective earth conductors, damage machines and electronic devices and cause overheating of components, leading to fire.

- Check that all welding current connections are firmly secured and electrical connections are in perfect condition.
- Set up, attach or suspend all conductive power source components such as casing, transport vehicles and crane frames so they are insulated.
- Do not place any other electronic devices such as drills or angle grinders on the power source, transport vehicle or crane frames unless they are insulated.
- Always put welding torches and electrode holders on an insulated surface when they are not in use.

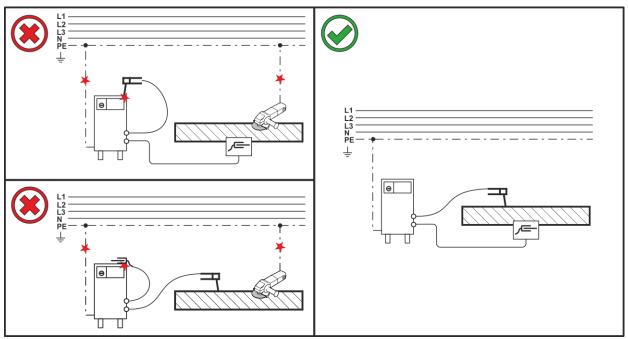


Figure 5-4

5.1.7 Mains connection



▲ DANGER

Hazards caused by improper mains connection!

An improper mains connection can cause injuries or damage property!

- The connection (mains plug or cable), the repair or voltage adjustment of the device must be carried out by a qualified electrician in accordance with the respective local laws or national regulations!
- The mains voltage indicated on the rating plate must match the supply voltage.
- Only operate machine using a socket that has correctly fitted protective earth.
- Mains plug, socket and lead must be checked by a qualified electrician on a regular basis!
- When operating the generator, always ensure it is earthed as stipulated in the operating instructions. The network created must be suitable for operating machines according to protection class I.




5.1.7.1 Mains configuration

The machine may be connected to:

- · a three-phase system with four conductors and an earthed neutral conductor
- · a three-phase system with three conductors of which any one can be earthed,

e.g. the outer conductor

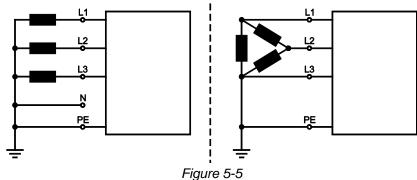

Legend

Item	Designation	Colour code
L1	Outer conductor 1	brown
L2	Outer conductor 2	black
L3	Outer conductor 3	grey
N	Neutral conductor	blue
PE	Protective conductor	green-yellow

[·] Insert mains plug of the switched-off machine into the appropriate socket.

5.2 MMA welding





Risk of crushing and burns!

When changing stick electrodes there is a risk of crushing and burns!

- Wear appropriate and dry protective gloves.
- Use an insulated pair of tongs to remove the used stick electrode or to move welded workpieces.

5.2.1 Connecting the electrode holder and workpiece lead

Polarity depends on the instructions from the electrode manufacturer given on the electrode packaging.

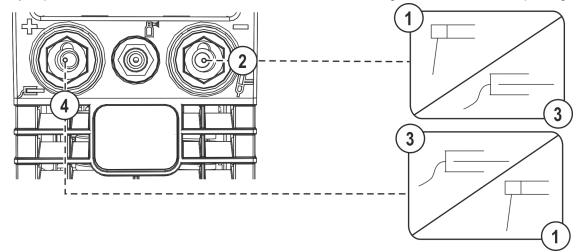


Figure 5-6



Item	Symbol	Description
1	F	Electrode holder
2		Connection socket, "-" welding current Workpiece lead or electrode holder connection
3	/ ■	Workpiece
4	+	Connection socket for "+" welding current Electrode holder or workpiece lead connection

- Insert cable plug of the electrode holder into either the "+" or "-" welding current connection socket and lock by turning to the right.
- Insert cable plug of the workpiece lead into either the "+" or "-" welding current connection socket and lock by turning to the right.

5.2.2 Welding task selection

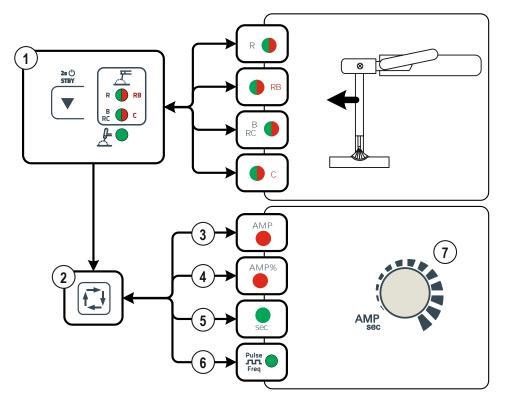


Figure 5-7



Item	Symbol	Description		
1		Welding procedure/power-saving mode push-button		
	▼	₹ Selection of MMA welding procedure/electrode type setting		
		Signal light R R RB illuminated in green = electrode type rutile		
		Signal light R R RB illuminated in red = electrode type rutile basic		
		Signal light R old cilluminated in green = electrode type basic/rutile cellulose		
		Signal light R old oil cilluminated in red = electrode type cellulose		
		♣ Selection of TIG welding procedure		
		Press for 2 s to put the machine into power-saving mode. To reactivate, activate one of		
		the operating elements > see 5.6 chapter.		
2	→	Select welding parameters button		
	T₩	This button is used to select the welding parameters depending on the welding process		
		and operating mode used.		
3	AMP	Main current signal light		
-		Imin to Imax (1 A increments)		
4	AMP%	Hotstart current signal light		
5	sec	Hotstart time signal light		
6	Pulse	Pulse welding (average value pulses) signal light > see 5.2.6 chapter		
	Freq	On: Function switched on 👨		
		Not on: Function switched off of of the same of the		
		Flashing: Parameter selection and frequency setting FrE:		
7		Welding parameter setting rotary transducer		
		Setting of welding current and other welding parameter and their values		

5.2.3 Hotstart

The function hot start ensures a secure igniting of the arc and a sufficient heating to the still cold parent metal at the beginning of the welding process. The ignition takes place here with increased current (hot start current) over a certain time (hot start time).

 


Figure 5-8

Setting

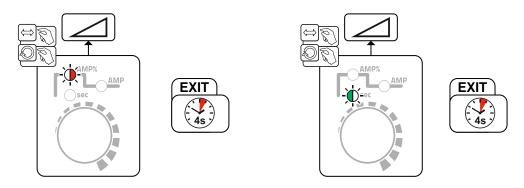


Figure 5-9


5.2.4 Arcforce

During the welding process, arcforce prevents the electrode sticking in the weld pool with increases in current. This makes it easier to weld large-drop melting electrode types at low current strengths with a short arc in particular.

For parameter setting, > see 5.2.7 chapter.



5.2.5 Antistick

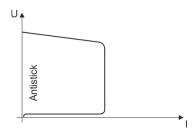


The Antistick feature prevents the electrode from annealing.

Should the electrode stick despite the Arcforce feature, the machine automatically switches to the minimum current within approx. one second. This prevents the electrode from annealing. Check the welding current setting and correct for the welding task in hand.

Figure 5-10

5.2.6 Average value pulse welding

Average value pulse welding means that two currents are switched periodically, a current average value (AMP), a pulse current (Ipuls), a balance (\underline{bRL}) and a frequency (\underline{FrE}) having been defined first. The predefined ampere current average value is decisive, the pulse current (Ipuls) is defined by the \underline{FPL} parameter as a percentage of the current average value (AMP). The pulse pause current (IPP) requires no setting. This value is calculated by the machine control, so that the welding current average value (AMP) is maintained at all times.

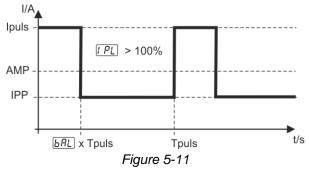

AMP = Main current; e.g. 100 A

Ipuls = Pulse current = [PL] x AMP; e.g. 140% x 100 A = 140 A

IPP = Pulse pause current

Tpuls = Duration of one pulse cycle = $1\sqrt{FrE}$; e.g. 1/1 Hz = 1 s

BRL = Balance

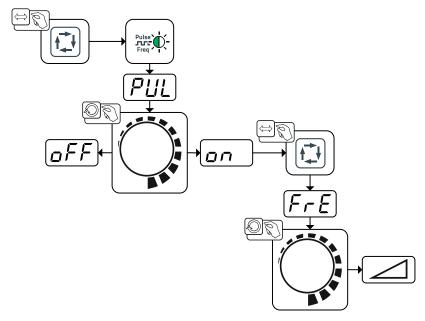


Figure 5-12



Display	Setting/selection
	Pulse welding (average value pulses)
	Function switched on
	<u>off</u> Function switched off (ex works)
FrE	Pulse frequency

More parameters can be set in the Expert menu > see 5.2.7 chapter.

5.2.7 **Expert menu (MMA)**

The Expert menu has adjustable parameters stored that don't require regular setting. The number of parameters shown may be limited, e.g. if a function is deactivated.

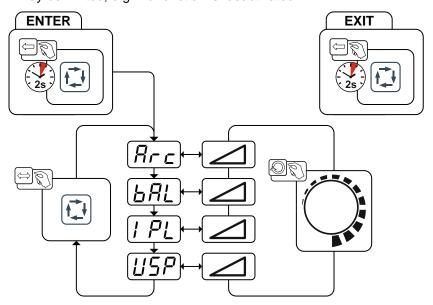


Figure 5-13

Display	Setting/selection
Rrc	Arcforce correction
/ / / <u> </u>	Increase value > harder arc
	Decrease value > softer arc
BAL	Pulse balance
[PL]	Pulse current > see 5.2.6 chapter
	Arc length restriction > see 5.7 chapter
	Function switched on
	<u>oFF</u> Function switched off

The setting ranges for the parameter values are summarised in the Parameter overview section > see 10.1.3 chapter.



 
5.3 TIG welding

5.3.1 Shielding gas supply (shielding gas cylinder for welding machine)

⚠ WARNING

Risk of injury due to improper handling of shielding gas cylinders! Improper handling and insufficient securing of shielding gas cylinders can cause serious injuries!


- Place shielding gas cylinder into the designated holder and secure with fastening elements (chain/belt)!
- Attach the fastening elements within the upper half of the shielding gas cylinder!
- The fastening elements must tightly enclose the shielding gas cylinder!



An unhindered shielding gas supply from the shielding gas cylinder to the welding torch is a fundamental requirement for optimum welding results. In addition, a blocked shielding gas supply may result in the welding torch being destroyed.

- Always re-fit the yellow protective cap when not using the shielding gas connection.
- · All shielding gas connections must be gas tight.

5.3.1.1 Connecting the shielding gas supply

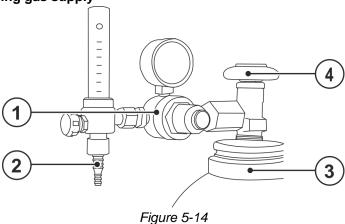

Item	Symbol	Description
1		Pressure regulator
2		Shielding gas cylinder
3		Output side of the pressure regulator
4		Cylinder valve

- Before connecting the pressure regulator to the gas cylinder, open the cylinder valve briefly to blow out any dirt.
- Tighten the pressure regulator screw connection on the gas bottle valve to be gas-tight.
- Screw the shielding gas hose of the welding torch to the pressure regulator outlet.



5.3.2 Connecting a TIG welding torch with rotating gas valve

Prepare welding torch according to the welding task in hand (see operating instructions for the torch).

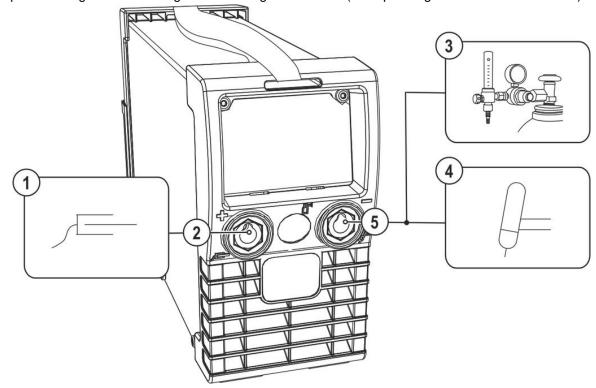


Figure 5-15

Item	Symbol	Description
1	∕■	Workpiece
2	+	Connection socket for "+" welding current Workpiece lead connection
3		Output side of the pressure regulator
4	₽	Welding torch
5		Connection socket, "-" welding current Welding current lead connection for TIG welding torch

- Insert the welding current plug on the welding torch into the welding current connection socket and lock by turning to the right.
- Insert the cable plug on the work piece lead into the "+" welding current connection socket and lock by turning to the right.
- Screw the shielding gas hose of the welding torch to the pressure regulator outlet.

5.3.3 Welding task selection


 


Figure 5-16



5.3.4 Arc ignition

5.3.4.1 Liftarc

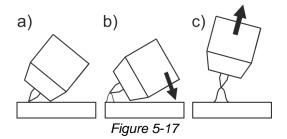


The arc ignites through contact with the workpiece:

- a) Carefully place the torch gas nozzle and tungsten electrode tip against the workpiece (lift arc current flows independent of the set main current)
- b) Angle the torch above the torch gas nozzle until the distance between electrode tip and workpiece is approx. 2–3 mm (arc ignites, current increases to the set main current).
- c) Lift the torch off and bring into normal position.

Complete the welding task: Remove the torch from the workpiece so that the arc extinguishes.

5.3.5 Average value pulse welding

Average value pulse welding means that two currents are switched periodically, a current average value (AMP), a pulse current (Ipuls), a balance $(\underbrace{\mathbb{LRL}})$ and a frequency $(\underbrace{\mathbb{LRL}})$ having been defined first. The predefined ampere current average value is decisive, the pulse current (Ipuls) is defined by the $\underbrace{\mathbb{LRL}}$ parameter as a percentage of the current average value (AMP). The pulse pause current (IPP) requires no setting. This value is calculated by the machine control, so that the welding current average value (AMP) is maintained at all times.

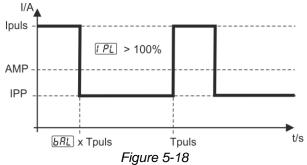

AMP = Main current; e.g. 100 A

Ipuls = Pulse current = [PL] x AMP; e.g. 140% x 100 A = 140 A

IPP = Pulse pause current

Tpuls = Duration of one pulse cycle = 1/(F - E); e.g. 1/1 Hz = 1 s

 \overline{BRL} = Balance



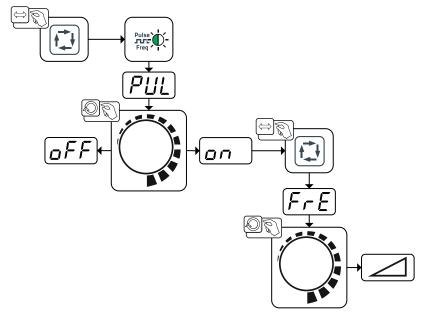


Figure 5-19

Display	Setting/selection
	Pulse welding (average value pulses)
	an Function switched on
	<u>oFF</u> Function switched off (ex works)
	Pulse frequency

More parameters can be set in the Expert menu > see 5.3.6 chapter.

5.3.6 **Expert menu (TIG)**

The Expert menu has adjustable parameters stored that don't require regular setting. The number of parameters shown may be limited, e.g. if a function is deactivated.

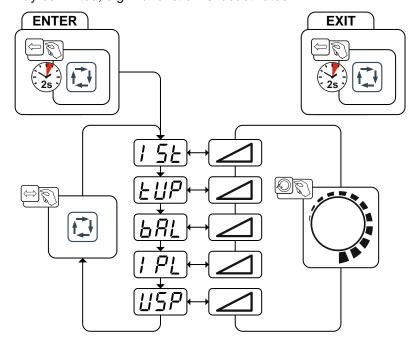


Figure 5-20



Display	Setting/selection
[5E	Ignition current (as percentage, dependent on main current)
LUP	Upslope time to main current
<u>BAL</u>	Pulse balance
[PL	Pulse current > see 5.3.5 chapter
[[[Arc length restriction > see 5.7 chapter
	Function switched on
	oFFFunction switched off

The setting ranges for the parameter values are summarised in the Parameter overview section > see 10.1.3 chapter.

5.4 Dirt filter

These accessory components can be retrofitted as an option > see 9 chapter.

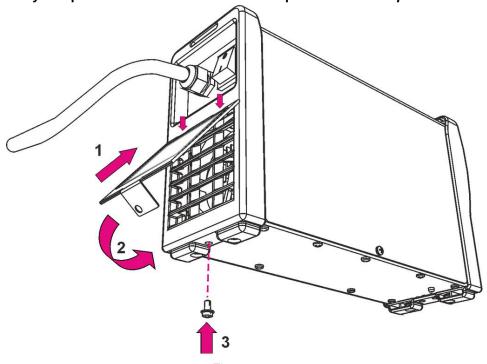


Figure 5-21

- As shown in the diagram, insert the dirt filter into the rear of the machine, above the air inlet, using both clips (1).
- Fold down the dirt filter (2).
- Fasten the dirt filter to the underside of the machine (3) using fixing screws.

The duty cycle of the welding machine decreases as an effect of the reduced cooling air volume. The dirt filter must be remove at regular intervals and cleaned by blowing out with compressed air (depending on the level of soiling).

5.5 Remote control

The remote controls are operated on the 19-pole remote control connection socket (analogue).

5.5.1 RT1 19POL



Functions

• Infinitely adjustable welding current (0% to 100%) depending on the preselected main current on the welding machine.

Power-saving mode (Standby)



5.5.2 RTG1 19POL



Functions

• Infinite setting of the welding current (0% to 100%) depending on the main current preselected at the welding machine

5.5.3 RTF1 19POL



Functions

- Infinitely adjustable welding current (0% to 100%) depending on the preselected main current on the welding machine.
- Start/stop welding operation (TIG)

5.6 Power-saving mode (Standby)

You can activate the power-saving mode by either pressing the push-button > see 4.3 chapter for a prolonged time or by setting a parameter in the machine configuration menu (time-controlled power-saving mode 5.9 chapter.

When power-saving mode is activated, the machine displays show the horizontal digit in the centre of the display only.

Pressing any operating element (e.g. turning a rotary knob) deactivates power-saving mode and the machine is ready for welding again.

5.7 Arc length restriction (USP)

The arc length restriction <u>USP</u> function stops the welding process when an excessive arc voltage is detected (unusually high gap between electrode and workpiece). This function can be adjusted in the corresponding Expert menu, depending on the process:

MMA welding > see 5.2.7 chapter

TIG welding > see 5.3.6 chapter

The arc length restriction cannot be used for cel characteristics (if available).

5.8 Voltage reducing device

Only machine variants with the (VRD/SVRD/AUS/RU) code are equipped with a voltage reduction device (VRD). The VRD is used for increased safety, especially in hazardous environments such as shipbuilding, pipe construction or mining.

A VRD is mandatory in some countries and required by many on-site safety instructions for power sources.

The VRD > see 4.3 chapter signal light is illuminated when the voltage reduction device is operating without fault and the output voltage is reduced to a value specified in the relevant standard (see technical data > see 8 chapter).

099-002057-EW501 04.03.2019



Machine configuration menu 5.9

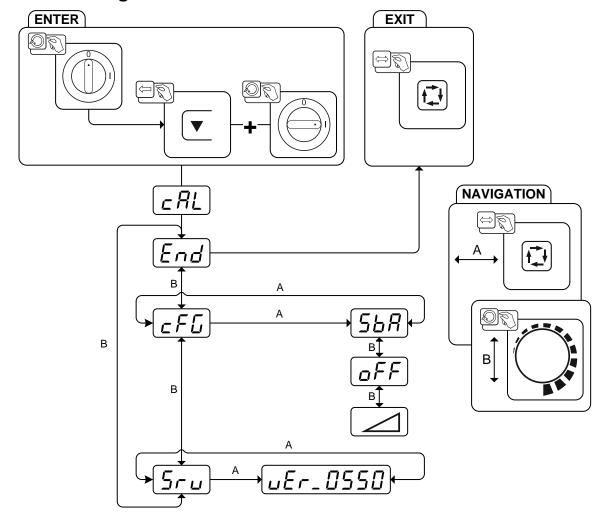


Figure 5-22

Display	Setting/selection
c Bi	Calibration
	The machine will be calibrated for approx 2 seconds each time it is switched on.
Fod	Exit the menu
	Exit
[- F [.]	Machine configuration
	Settings for machine functions and parameter display
$\Box \Box \Box$	Time-based power-saving
	mode <dg_ref_source_inline>Energiesparfunktion</dg_ref_source_inline>
	Time to activation of the power-saving mode in case of inactivity.
-	Setting <u>off</u> = disabled or numerical value 5-60 min
<u> </u>	Service menu
עויב	Any changes to the service menu should be agreed with the authorised service
	personnel.
[Software version of the machine control
	Version display



6 Maintenance, care and disposal

6.1 General

⚠ DANGER

Risk of injury due to electrical voltage after switching off! Working on an open machine can lead to fatal injuries! Capacitors are loaded with electrical voltage during operation. Voltage remains present for up to four minutes after the mains plug is removed.

- 1. Switch off machine.
- 2. Remove the mains plug.
- 3. Wait for at last 4 minutes until the capacitors have discharged!

WARNING



Incorrect maintenance, testing and repair!

Maintenance, testing and repair of the machine may only be carried out by skilled and qualified personnel. A qualified person is one who, because of his or her training, knowledge and experience, is able to recognise the dangers that can occur while testing welding power sources as well as possible subsequent damage, and who is able to implement the required safety procedures.

Observe the maintenance instructions > see 6.3 chapter.

In the event that the provisions of one of the below-stated tests are not met, the machine must not be operated again until it has been repaired and a new test has been carried out!

Repair and maintenance work may only be performed by qualified authorised personnel; otherwise the right to claim under warranty is void. In all service matters, always consult the dealer who supplied the machine. Return deliveries of defective equipment subject to warranty may only be made through your dealer. When replacing parts, use only original spare parts. When ordering spare parts, please quote the machine type, serial number and item number of the machine, as well as the type designation and item number of the spare part.

Under the specified ambient conditions and normal working conditions this machine is essentially maintenance-free and requires just a minimum of care.

Contamination of the machine may impair service life and duty cycle. The cleaning intervals depend on the ambient conditions and the resulting contamination of the machine. The minimum interval is every six months.

6.2 Cleaning

- Clean the outer surfaces with a moist cloth (no aggressive cleaning agents).
- Purge the machine venting channel and cooling fins (if present) with oil- and water-free compressed air. Compressed air may overspeed and destroy the machine fans. Never direct the compressed air directly at the machine fans. Mechanically block the fans, if required.
- Check the coolant for contaminants and replace, if necessary.

6.2.1 **Dirt filter**

The duty cycle of the welding machine decreases as an effect of the reduced cooling air volume. The dirt filter must be remove at regular intervals and cleaned by blowing out with compressed air (depending on the level of soiling).

> 099-002057-EW501 04.03.2019

Maintenance, care and disposal





6.3 Maintenance work, intervals

6.3.1 Daily maintenance tasks

Visual inspection

- · Mains supply lead and its strain relief
- Gas cylinder securing elements
- Check hose package and power connections for exterior damage and replace or have repaired by specialist staff as necessary!
- Gas tubes and their switching equipment (solenoid valve)
- Check that all connections and wearing parts are hand-tight and tighten if necessary.
- Check correct mounting of the wire spool.
- Wheels and their securing elements
- Transport elements (strap, lifting lugs, handle)
- · Other, general condition

Functional test

- Operating, message, safety and adjustment devices (Functional test)
- Welding current cables (check that they are fitted correctly and secured)
- · Gas tubes and their switching equipment (solenoid valve)
- · Gas cylinder securing elements
- · Check correct mounting of the wire spool.
- Check that all screw and plug connections and replaceable parts are secured correctly, tighten if necessary.
- · Remove any spatter.
- · Clean the wire feed rollers on a regular basis (depending on the degree of soiling).

6.3.2 Monthly maintenance tasks

Visual inspection

- Casing damage (front, rear and side walls)
- · Wheels and their securing elements
- Transport elements (strap, lifting lugs, handle)
- Check coolant tubes and their connections for impurities

Functional test

- Selector switches, command devices, emergency stop devices, voltage reducing devices, message and control lamps
- Check that the wire guide elements (inlet nipple, wire guide tube) are fitted securely.
- · Check coolant tubes and their connections for impurities
- Check and clean the welding torch. Deposits in the torch can cause short circuits and have a negative impact on the welding result, ultimately causing damage to the torch.

6.3.3 Annual test (inspection and testing during operation)

A periodic test according to IEC 60974-4 "Periodic inspection and test" has to be carried out. In addition to the regulations on testing given here, the relevant local laws and regulations must also be observed. For more information refer to the "Warranty registration" brochure supplied and our information regarding warranty, maintenance and testing at www.ewm-group.com!

Maintenance, care and disposal

Disposing of equipment



6.4 Disposing of equipment



Proper disposal!

The machine contains valuable raw materials, which should be recycled, and electronic components, which must be disposed of.

- · Do not dispose of in household waste!
- · Observe the local regulations regarding disposal!
- According to European provisions (Directive 2012/19/EU on Waste of Electrical and Electronic
 Equipment), used electric and electronic equipment may no longer be placed in unsorted municipal
 waste. It must be collected separately. The symbol depicting a waste container on wheels indicates
 that the equipment must be collected separately.
 - This machine has to be disposed of, or recycled, in accordance with the waste separation systems in use.
- According to German law (law governing the distribution, taking back and environmentally correct disposal of electric and electronic equipment (ElektroG)), used machines are to be placed in a collection system separate from unsorted municipal waste. The public waste management utilities (communities) have created collection points at which used equipment from private households can be disposed of free of charge.
- Information about returning used equipment or about collections can be obtained from the respective municipal administration office.
- In addition to this, returns are also possible throughout Europe via EWM sales partners.

36 099-002057-EW501



7 Rectifying faults

All products are subject to rigorous production checks and final checks. If, despite this, something fails to work at any time, please check the product using the following flowchart. If none of the fault rectification procedures described leads to the correct functioning of the product, please inform your authorised dealer.

7.1 Checklist for rectifying faults

The correct machine equipment for the material and process gas in use is a fundamental requirement for perfect operation!

Legend	Symbol	Description
	₩	Fault/Cause
	*	Remedy

Excess temperature signal light illuminates

- ✓ Excess temperature, welding machine
 - Allow the machine to cool down whilst still switched on

Functional errors

- ✓ No machine control signal light is illuminated after switching on
- ✓ No welding power
 - ★ Phase failure > check mains connection (fuses)
- ✓ Connection problems
 - * Make control lead connections and check that they are fitted correctly.
- ✓ Loose welding current connections
 - ★ Tighten power connections on the torch and/or on the workpiece
 - ★ Tighten contact tip correctly



7.2 Machine faults (error messages)

A welding machine error is indicated by the collective fault signal lamp (A1) lighting up and an error code (see table) being displayed in the machine control display. In the event of a machine error, the power unit shuts down.

The display of possible error numbers depends on the machine version (interfaces/functions).

- If multiple errors occur, these are displayed in succession.
- Document machine errors and inform service staff as necessary.

Error message	Possible cause	Remedy
E 0	Start signal set in the event of errors	Do not press the torch trigger or the foot- operated remote control
E 4	Temperature error	Allow the machine to cool down
E 5	Mains overvoltage	Switch off the machine and check the mains
E 6	Mains undervoltage	voltage
E 7	Electronics error	Switch the machine on and off again.
E 9	Secondary overvoltage	If the error persists, notify service department
E12	Voltage reduction error (VRD)	
E13	Electronics error	
E14	Adjustment error in current recording	Switch off the machine, place the electrode holder in an insulated position and switch the machine back on. If the error persists, notify service department
E15	Error in on of the electronics supply voltages	Switch the machine off and on again. If the error persists, notify service department
E23	Temperature error	Allow the machine to cool down
E32	Electronics error	Switch the machine on and off again. If the error persists, notify service department
E33	Adjustment error in voltage recording	Switch off the machine, place the electrode holder in an insulated position and switch the machine back on. If the error persists, notify service department
E34	Electronics error	Switch the machine on and off again. If the error persists, notify service department
E37	Temperature error	Allow the machine to cool down
E40	Motor fault	Check wire feed unit, switch the machine off and on again, inform the service department if the fault persists.
E55	Failure of a mains phase	Switch off the machine and check the mains voltage
E58	Short circuit in welding circuit	Switch off machine and check welding current leads for correct installation, e.g., put down electrode holder in an electrically insulated manner, disconnect degausser current lead.

7.3 Display machine control software version

The query of the software versions only serves to inform the authorised service staff. It is available in the machine configuration menu > see 5.9 chapter.



7.4 Resetting welding parameters to the factory settings

All customised welding parameters that are stored will be replaced by the factory settings.

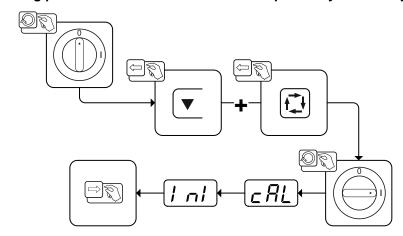


Figure 7-1

Display	Setting/selection
c RL	Calibration
	The machine will be calibrated for approx 2 seconds each time it is switched on.
[Initialising
1 111	Keep the push-button pressed until [r] is shown on the display.



8 Technical data

Performance specifications and guarantee only in connection with original spare and replacement parts!

8.1 Pico 220 cel puls

	MMA	TIG
Welding current (I ₂)	10 A to 220 A	
Welding voltage according to standard (U ₂)	20,4 V to 28,8 V	10,4 V to 18,8 V
Duty cycle DC at 40° C [1]	220 A (30 %)
	160 A (•
	140 A (1	100 %)
Open circuit voltage (U ₀)	97	V
Mains voltage (Tolerance)	3 x 400 V (-25	% to +20 %)
Frequency	50/60) Hz
mains fuse [2]	3 x 1	0 A
Mains connection cable	H07RN-	F4G1,5
max. Connected load (S ₁)	8,0 kVA	5,2 kVA
Rec. Generator rating	11 k	VA
Cos φ / efficiency	0,99 / 88 %	
Protection class	I	
Overvoltage category	II	[
Contamination level	3	
Insulation class / protection classification	H / IF	23
Residual current circuit breaker	Type B (reco	ommended)
Noise level [3]	<70 dB(A)	
Ambient temperature	-25 °C to +40 °C	
Machine cooling	Fan (AF)	
Torch cooling	-	gas
Workpiece lead (min.)	35 mm ²	
EMC class	A	
Safety marking	C€/S/EMI	
Standards used	See declaration of conformity (appliance documents)	
Dimensions L / B / H	428 x 136	x 252 mm
	16.9 x 5.4	x 9.9 inch
Weight	10,5	kg
	23.1	lb.

^[1] Load cycle: 10 min. (60 % DC \triangleq 6 min. welding, 4 min. pause)

099-002057-EW501 04.03.2019

^[2] Safety fuses are recommended DIAZED xxA gG. When using automatic cutouts, the "C" trigger characteristic must be used.

Noise level during idle mode and operation under standard load according to IEC 60974- 1 at the maximum operating point.



9 Accessories

Performance-dependent accessories like torches, workpiece leads, electrode holders or intermediate hose packages are available from your authorised dealer.

9.1 Transport systems

Туре	Designation	Item no.
Trolly 35-1	Transport vehicle	090-008629-00000

9.2 Remote controls and accessories

Туре	Designation	Item no.
RT1 19POL	Remote control current	090-008097-00000
RTG1 19POL 5m	Remote control, current	090-008106-00000
RTF1 19POL 5 M	Foot-operated remote control current with connection cable	094-006680-00000
RA5 19POL 5M	Remote control e.g. connection cable	092-001470-00005
RA10 19POL 10m	Remote control e.g. connection cable	092-001470-00010
RA20 19POL 20m	Remote control e.g. connection cable	092-001470-00020
RV5M19 19POLE 5M	Extension cable	092-000857-00000

9.3 General accessories

Туре	Designation	Item no.
16A 5POLE/CEE	Mains plug	094-000712-00000
DM 842 Ar/CO2 230bar 30l D	Pressure regulator with manometer	394-002910-00030
GH 2X1/4" 2M	Gas hose	094-000010-00001

9.4 Options

Туре	Designation	Item no.
ON Filter T.0003	Dirt filter for air inlet	092-002546-00000
ON Safeguard T.0003	Insulating protective cover	092-008767-00000
ON AL D13/27	Cap for load sockets	092-003282-00000



10 **Appendix**

Parameter overview 10.1

10.1.1 MMA welding

_	Parameters/function	Setting range					
Display, welding data		Standard (ex works)	min.		max.	Unit	
PUL	Pulse welding	off	off	-	on		
FrE	Pulse frequency	1,2	0,2	-	500	Hz	
	Hot start current (AMP%)	120	50	-	200	%	
	Hot start time	0,5	0,1	1	20,0	S	
Arc	Arcforce correction	0	-10	-	10		
ЬЯL	Pulse balance	30	1	-	99	%	
I PL	Pulse current	142	1	-	200	%	
USP	Arc length restriction	off	off	-	on		

10.1.2 TIG welding

gu	Parameters/function	Setting range				
Display, welding data		Standard (ex works)	min.		тах.	Unit
PUL	Pulse welding	off	off	1	on	
FrE	Pulse frequency	2,8	0,2	1	2000	Hz
1 SE	Ignition current	20	1	ı	200	%
EUP	Up-slope time	1,0	0,0	ı	20,0	S
ЬЯL	Pulse balance	50	1	1	99	%
I PL	Pulse current	140	1	•	200	%
USP	Arc length restriction	on	off	-	on	



10.1.3 Basic parameters (independent of process)

	Parameters/function	Setting range				
Welding data display		Standard (ex works)	min.		max.	Unit
٥٥	Switched on					
oFF	Switched off					
c RL	Calibration					
Inl	Initialisation					
сҒБ	Machine configuration					
End	Exit menu					
5ru	Service menu					
5bR	Time-based power-saving mode	off	5	•	60	min.
-	Power-saving mode active				_	



Searching for a dealer 10.2

Sales & service partners www.ewm-group.com/en/specialist-dealers



"More than 400 EWM sales partners worldwide"